



由于ACP错误、发生接管

https://kb-cn-stage.netapp.com/on-prem/ontap/OHW/OHW-KBs/Takeover_occurs_due_to_ACP_error

Updated: Wed, 22 Apr 2026 07:33:17 GMT

适用场景

FAS2240

问题描述

发生接管、并输出以下错误。

```
Node1> rdfile /etc/messages
```

```
Mon Mar 1 22:37:02 JST [Node1:ses.status.ACPError:CRITICAL]: DS2246 (S/N
9414396798) shelf 0 on channel 0a ACP Processor error for SAS shelf ACP
processor 1: critical status ; Alternate Control Path hardware failed This
module is on the rear side of the shelf, at the top left, on shelf module
A.
Mon Mar 1 22:38:24 JST [Node1:ses.status.ACPInfo:info]: DS2246 (S/N
9414396798) shelf 0 on channel 0a ACP Processor information for SAS shelf
ACP processor 1: normal status.
Mon Mar 1 22:39:34 JST [Node1:cf.hwassist.takeoverTrapRecv:notice]:
```

'NetApp provides no representations or warranties regarding the accuracy or reliability or serviceability of any information or recommendations provided in this publication or with respect to any results that may be obtained by the use of the information or observance of any recommendations provided herein. The information in this document is distributed AS IS and the use of this information or the implementation of any recommendations or techniques herein is a customers responsibility and depends on the customers ability to evaluate and integrate them into the customers operational environment. This document and the information

```
hw_assist: Received takeover hw_assist alert from partner(Node2),  
system_down because l2_watchdog_reset.
```

```
Node1> environment status
```

```
ACP installed element list: 1, 2; with error: 1
```

重新安装控制器无法解决此问题描述。