



H410S上的SensorReadingFaif警报

https://kb-cn-stage.netapp.com/on-prem/SolidFire/Element_OS_Kbs/SensorReadingFailed_alert_on_H...

Updated: Wed, 22 Apr 2026 03:53:50 GMT

适用场景

- NetApp Element软件
- NetApp H410S (H300S、H500S、H700S)

问题描述

SolidFire ActiveIQ中可能会显示以下错误：

- `Error checking sensor for Inlet Temp (10193x)`
- `Error checking sensor for FanX RPM (10193x)`

同时，[从管理节点\(mNode\)运行ipmitool时](#)，各种Temp传感器的输出将显示 Fail 状态(而不是预期的 OK)：

- `sudo ipmitool -I lanplus -H <node-BMC-IP-address> -U <BMC-username> -P <BMC-password> sdr`

'NetApp provides no representations or warranties regarding the accuracy or reliability or serviceability of any information or recommendations provided in this publication or with respect to any results that may be obtained by the use of the information or observance of any recommendations provided herein. The information in this document is distributed AS IS and the use of this information or the implementation of any recommendations or techniques herein is a customers responsibility and depends on the customers ability to evaluate and integrate them into the customers operational environment. This document and the information

```

sfadmin@NODE /usr/bin $ sudo ./smc-ipmicfg -sdr
Status | (#)Sensor          | Reading | Low Limit | High Limit |
-----|-----|-----|-----|-----|
Fail | (4) CPU1 Temp      | N/A     | N/A       | 98C/208F  |
Fail | (71) CPU2 Temp     | N/A     | N/A       | 98C/208F  |
Fail | (138) PCH Temp     | N/A     | 5C/41F   | 95C/203F  |
Fail | (205) System Temp  | N/A     | -5C/23F  | 85C/185F  |
---omitted---

```