



# CXone Mpower EXPERT

## 升级后、Brocade交换机无法使用新固件启动

[https://kb-cn-stage.netapp.com/on-prem/Switches/Brocade-KBs/Post\\_upgrade\\_Brocade\\_switch\\_is\\_not...](https://kb-cn-stage.netapp.com/on-prem/Switches/Brocade-KBs/Post_upgrade_Brocade_switch_is_not...)

Updated: Wed, 22 Apr 2026 10:27:35 GMT

### 适用场景

Brocade光纤通道(FC)交换机

### 问题描述

从8.2.3版升级到9.0.1D版后、FOS版本显示的是旧版本、而不是最新版本。

```
Switchxxx:admin> version
Kernel:      2.6.34.6
Fabric OS:   v8.2.3
Made on:     Wed Feb 24 20:04:13 2021
Flash:       Mon Jan 24 08:52:08 2022
BootProm:    3.0.32
```

`firmwareshow -v` 显示二级分区已升级到最新版本、而主分区仍显示旧版本、并且存在一条警告  
`firmwaredownloadstatus`、指出尽管显示固件已下载、但固件下载仍在进行中。

'NetApp provides no representations or warranties regarding the accuracy or reliability or serviceability of any information or recommendations provided in this publication or with respect to any results that may be obtained by the use of the information or observance of any recommendations provided herein. The information in this document is distributed AS IS and the use of this information or the implementation of any recommendations or techniques herein is a customers responsibility and depends on the customers ability to evaluate and integrate them into the customers operational environment. This document and the information

```
Switchxxx:admin> firmwareshow -v
Appl      Primary/Secondary Versions
```

```
-----
FOS       v8.2.3
          v9.0.1d
```

```
WARNING: Firmwaredownload is in progress.
```

```
Switchxxx:admin>
```

```
Switchxxx:admin>firmwaredownloadstatus
```

```
[1]: Tue Aug 30 10:00:54 2022
```

```
Firmware is being downloaded to the switch. This step may take up to 30 minutes.
```

```
[2]: Tue Aug 30 10:08:28 2022
```

```
Firmware has been downloaded to the secondary partition of the switch.
```