



Brocade Director Switch 上的 Switch Blade 报告故障

https://kb-cn-stage.netapp.com/on-prem/Switches/Brocade-KBs/Switch_Blade_reported_faulty_on_a_B...

Updated: Wed, 22 Apr 2026 03:53:47 GMT

适用场景

博科 X6-4、X6-8

问题描述

- 交换机刀片上的所有端口均被禁用或未在 `switchshow` 中显示：

```
Index Slot Port Address Media Speed State Proto
=====
96 11 0 0c6040 -- UN N/A FC Disabled
97 11 1 0c6140 -- UN N/A FC Disabled
98 11 2 0c6240 -- UN N/A FC Disabled
99 11 3 0c6340 -- UN N/A FC Disabled
100 11 4 0c6440 -- UN N/A FC Disabled
101 11 5 0c6540 -- UN N/A FC Disabled
102 11 6 0c6640 -- UN N/A FC Disabled
103 11 7 0c6740 -- UN N/A FC Disabled
104 11 8 0c6840 -- UN N/A FC Disabled
```

'NetApp provides no representations or warranties regarding the accuracy or reliability or serviceability of any information or recommendations provided in this publication or with respect to any results that may be obtained by the use of the information or observance of any recommendations provided herein. The information in this document is distributed AS IS and the use of this information or the implementation of any recommendations or techniques herein is a customers responsibility and depends on the customers ability to evaluate and integrate them into the customers operational environment. This document and the information

- errdump 报告刀片状态故障：

```
2022/03/15-05:46:45, [MAPS-1002], 115038, SLOT 1 | FID 128, ERROR, SWITCH1,
Blade 11, Condition=ALL_SLOTS(BLADE_STATE==FAULTY), Current Value:[BLADE_STATE,
FAULTY], RuleName=defALL_SLOTSBLADE_STATE_FAULTY, Dashboard Category=Fru
Health.
```

- slotshow 报告刀片故障

```
Slot Blade Type ID Model Name Status
-----
1 CP BLADE 175 CPX6 ENABLED
2 CP BLADE 175 CPX6 ENABLED
3 SW BLADE 178 FC32-48 ENABLED
4 SW BLADE 178 FC32-48 ENABLED
5 SW BLADE 178 FC32-48 ENABLED
6 SW BLADE 178 FC32-48 ENABLED
7 CORE BLADE 177 CR32-8 ENABLED
8 CORE BLADE 177 CR32-8 ENABLED
9 SW BLADE 178 FC32-48 ENABLED
10 SW BLADE 178 FC32-48 ENABLED
11 SW BLADE 178 FC32-48 FAULTY (21)
12 SW BLADE 178 FC32-48 ENABLED
```

- 刀片重新安装失败