



## CHW-2391：针对错误 1492208，安装 X1151A 适配器时 VifMgr 在固定的 ONTAP 版本上挂起

<https://kb-cn-stage.netapp.com/on-prem/ontap/OHW/OHW-Issues/CHW-2391>

Updated: Wed, 22 Apr 2026 07:30:22 GMT

### 问题描述

无法运行与网络相关的命令，如 'network interface show'、'network port show'。

运行其他命令时观察到速度缓慢。

'Event log show' 显示 "Nblade.longRunningRpcOp:error" 和 "vifmgr.rpc.nblade.timeouts:error"

Wed Sep 27 01:39:13 +0800 [Cluster-08: NBRpcSvrSched: Nblade.longRunningRpcOp:error]: 检测到 RPC 服务器 nitro\_cfg 的长期运行 RPC 操作（过程编号 20）。服务器在 263122 秒内没有响应，超过了 3600 秒的阈值。

Sun Sep 24 00:20:39 +0800 [Cluster-07: vifmgr: vifmgr.rpc.nblade.timeouts:error]: 虚拟接口管理器未收到节点网络组件的响应。

Sun Sep 24 00:24:45 +0800 [Cluster-07: vifmgr: vifmgr.rpc.nblade.timeouts:error]: 虚拟接口管理器未收到节点网络组件的响应。

Mon Sep 25 00:28:43 +0800 [Cluster-07: vifmgr: vifmgr.rpc.nblade.timeouts:error]: 虚拟接口管理器未收到节点网络组件的响应。

Wed Sep 27 01:38:27 +0800 [Cluster-07: vifmgr: vifmgr.rpc.nblade.timeouts:error]: 虚拟接口管理器未收到节点网络组件的响应。

'NetApp provides no representations or warranties regarding the accuracy or reliability or serviceability of any information or recommendations provided in this publication or with respect to any results that may be obtained by the use of the information or observance of any recommendations provided herein. The information in this document is distributed AS IS and the use of this information or the implementation of any recommendations or techniques herein is a customers responsibility and depends on the customers ability to evaluate and integrate them into the customers operational environment. This document and the information

Sysconfig -a 显示安装了 SFP 的 IONIC 卡：  
slot 3: Dual 100G Ethernet Controller IONIC  
e3a MAC Address: 00:ae:cd:0e:XX:XX (auto-unknown-down)  
QSFP Vendor: FINISAR CORP  
QSFP Part Number: 332-00440  
QSFP Serial Number: XXXXXXXX  
e3b MAC Address: 00:ae:cd:0e:XX:XX(auto-unknown-down)  
QSFP Vendor: FINISAR CORP  
QSFP Part Number: 332-00440  
QSFP Serial Number: XBBB99D  
Device Type: ionic  
Firmware Version: 1.4.0-E-96  
Serial Number: FPNXXXXXXXX