



# NiCE

---

## 光纤通道降压问题描述

[https://kb-cn-stage.netapp.com/on-prem/ontap/da/SAN/SAN-KBs/Fibre\\_Channel\\_dropout\\_issue](https://kb-cn-stage.netapp.com/on-prem/ontap/da/SAN/SAN-KBs/Fibre_Channel_dropout_issue)

Updated: Thu, 04 Jun 2026 05:24:17 GMT

### 适用场景

- ONTAP 8.2.3 或更早版本
- ONTAP 7-模式

### 问题描述

- FC LUN 无法访问
- 16 Gb 光纤通道 (FC) 适配器与 Brocade FC 交换机之间间歇性断开连接。
- EMS 中记录的错误如下：

```
[?] Fri Oct 24 13:34:54 BST [controller: fct_tpd_thread_1:
```

```
fcp.io.status:debug]: STIO Adapter:0c AEN
```

```
0x8048 (RECV_ERROR) MboxStatus1 0xffff MboxStatus2 0x1
```

```
[?] Fri Oct 24 13:34:58 BST [controller: fct_tpd_thread_1: fcp.io.status:debug]: STIO Adapter:0c, found hung  
cmd:0xfffff01e8b305e0(state=7, flags=0x1, ctio_sent=1/2,RecvExAddr=0x124f30, OX_ID=0x6b3,  
RX_ID=0xffff,SID=0x10200, Cmd[2A])
```